




LED Slim Downlight

OPPLE


Version date 10-06-2016
www.opple.com

Item Code	CCT	kg
-----------	-----	----

140056557	3000K	0.26kg
140056558	4000K	0.26kg
140056559	3000K	0.44kg
140056560	4000K	0.44kg
140056561	3000K	0.32kg
140056562	4000K	0.32kg
140056563	3000K	0.53kg
140056564	4000K	0.53kg

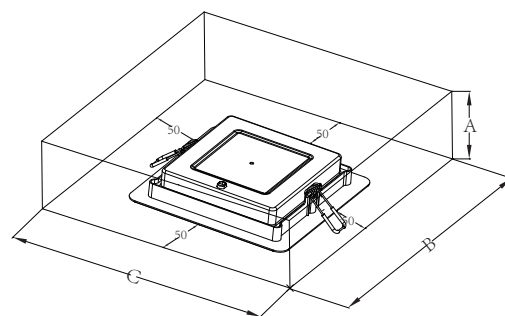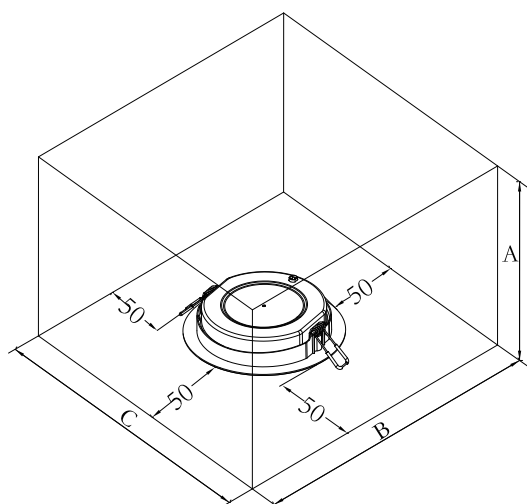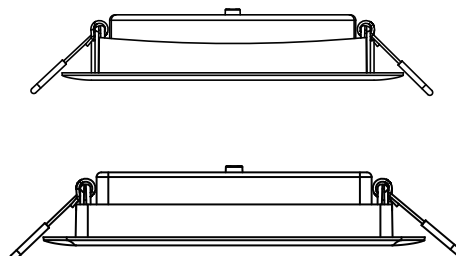


Type	A (mm)	B (mm)	C (mm)
LED DL-RC-E SL R150 12W	70	263	263
LED DL-RC-E SL R200 24W	70	313	313
LED DL-RC-E SL SQ 150 12W	70	263	263
LED DL-RC-E SL SQ 200 24W	70	313	313

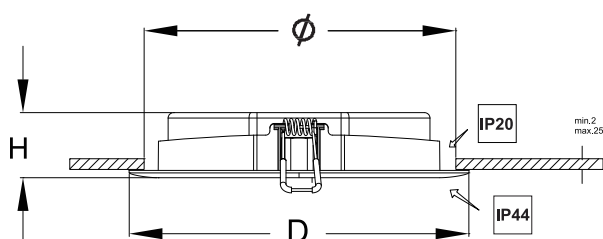


Type	H (mm)	φ (mm)	D (mm)
LED DL-RC-E SL R150 12W	31	150	163
LED DL-RC-E SL R200 24W	31	200	213
LED DL-RC-E SL SQ 150 12W	31	150×150	163
LED DL-RC-E SL SQ 200 24W	31	200×200	213

①

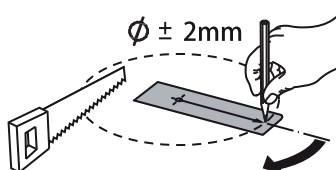



Type	φ (mm)
LED DL-RC-E SL R150 12W	150
LED DL-RC-E SL R200 24W	200
LED DL-RC-E SL SQ 150 12W	150×150
LED DL-RC-E SL SQ 200 24W	200×200

②

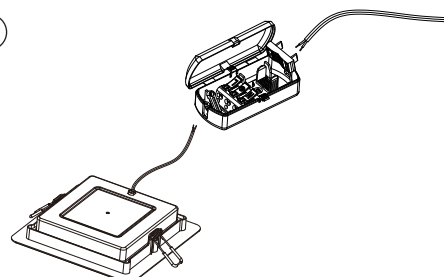


Connection terminal not provided

120052519

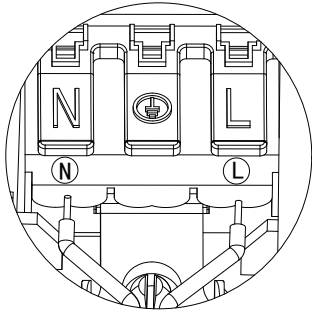


$2 \times 0.75\text{mm}^2 - 1.5\text{mm}^2$
 $\varnothing 6\text{mm} - \varnothing 9\text{mm}$




③

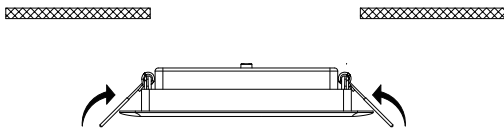

④

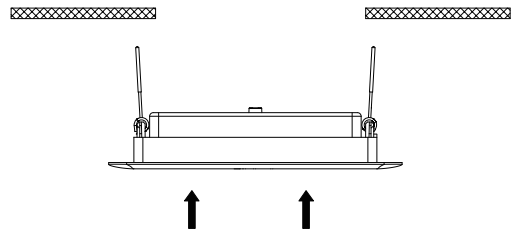

⑤

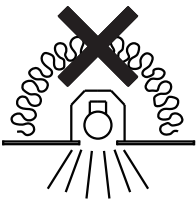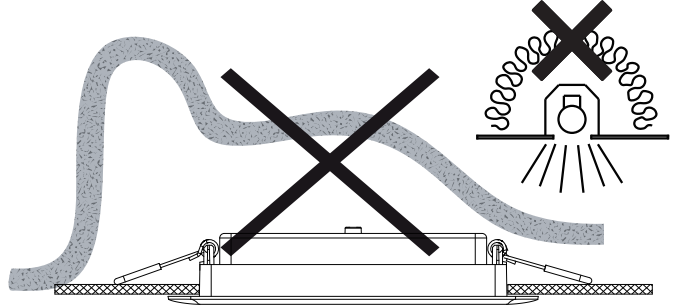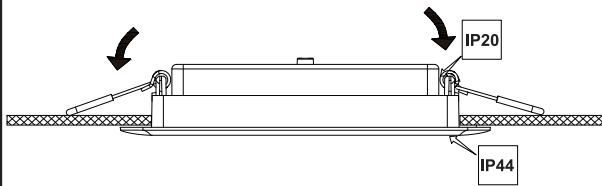

Luminaires not suitable for covering with thermally insulating material.
 Leuchten sind nicht mit thermisch isolierenden Materialien abzudecken.

In case of damage to the wire, it has to be replaced only by the manufacturer, distributor or by an expert, to avoid risks.







Caution: Any operation on LED module is forbidden while power-on.

Zur Vermeidung von Risiken müssen defekte Leitungen ausschließlich vom Hersteller, Inverkehrbringer oder Fachmann ausgetauscht werden.

Achtung: In Betrieb ist keine Arbeit am LED-Modul erlaubt.

The light source of this luminaire is not replaceable; when the light source reaches its end of life the whole luminaire shall be replaced.

Das Leuchtmittel dieser Leuchte ist nicht austauschbar. Wenn das Leuchtmittel das Ende seiner Lebensdauer erreicht hat, muss die gesamte Leuchte ersetzt werden.

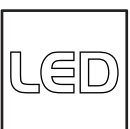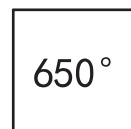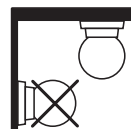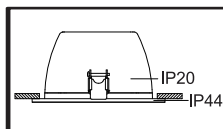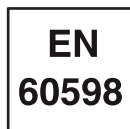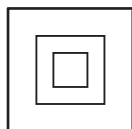

Suzhou Opple Lighting Co., Ltd.
 215200
 East Side, Fenyang Road,
 Fenu Economic Development Zone,
 Wujiang City, Jiangsu Province,
 P.R.China

OPPLE Lighting B.
 Materialweg 6-6A
 5681 RJ Best
 The Netherlands
 service@opple.com
 www.opple.com